

User's Guide


**EXTECH**<sup>®</sup>  
INSTRUMENTS

A FLIR COMPANY

Model 412355A Current / Voltage Calibrator



CE

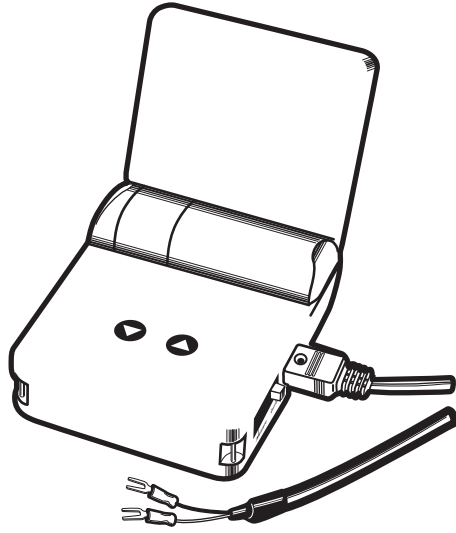

### POWER BUTTON and AUTO POWER OFF FEATURE

1. Use the POWER button to turn the unit ON or OFF. When the unit is powered up, a short self-test will ensue after which the display will stabilize.
2. This meter can either be powered by one 9V battery or an AC adapter.
3. When the battery symbol appears on the LCD display, replace the battery as soon as possible. Low battery power may cause inaccurate readings and erratic meter operation.
4. This instrument is equipped with Auto Power OFF which turns the meter off after 10 minutes of inactivity. To override this feature; press and hold the MODE button until the display shows **oA&P** (auto power off de-activated) or **A&P** (auto power off activated).

### FUNCTION SLIDE SWITCH

Slide the Function switch on the side of the meter to the desired function (Voltage or Current)

### MODE

Press the MODE button to select either SOURCE (output) or MEASURE (input)

### UNIT BUTTON

Press the UNIT button to select:

1. Voltage mode: mV or V in source.
2. Current mode: mA or % in source or measure

### ▲ ▼ OUTPUT ADJUST BUTTONS

Press the buttons to increase or decrease the output voltage or current value in the source mode.

1. Press the button once to increase the value in one digit steps.
2. Press and hold the button to increase the value in 10 digit steps.
3. Press and hold the button > 2 sec and then press the to increase the value in 100 digit steps
4. To decrease the value, use the button as described above.

### ZERO BUTTON

The ZERO button manually zeros the display in the MEASURE mode.

1. Set the meter to the MEASURE mode
2. Short the input jack
3. Press and release the ZERO button.

## MEM BUTTON

The memory feature provides 5 user settable source values for stepped calibration outputs. The feature is available for Voltage, mA and % in the SOURCE mode. The memory values are stored in nonvolatile memory and are not erased when power is turned off.

### Sourcing from the stored memory values:

1. Select the Source mode
2. Press the MEM button. The M1 icon (memory location 1) will appear in the display and the value stored in that location will be displayed and sourced.
3. Repeated pressing of the MEM button will step through the 5 memory locations.

**NOTE:** The "SOURCE" icon will blink when the output value has not reached a stable level. The common cause for the "SOURCE" icon to remain blinking is that the load impedance is too high in the current mode or too low in the voltage mode.

### Storing values into memory:

1. Select and display a memory location (M1 to M5)
2. Press the buttons to adjust the display to the desired source value.
3. Press and hold the MEM button for > 2 seconds. The displayed value will be stored into the displayed memory location.

### Default memory values.

Five common source values are permanently programmed in memory as the default values. These values can be replaced by user selected values.

To reset the meter to the default memory values:

1. Turn the meter on and select the SOURCE mode.
2. Press and hold the POWER button for >4 seconds. *dfL t* will briefly appear in the display and the default values will be stored into memory.

Default Memory Values					
	M1	M2	M3	M4	M5
mV	0mV	500mV	1000mV	1500mV	2000mV
V	2V	5V	10V	15V	20V
mA	4mA	8mA	12mA	16mA	20mA
%	0%	25%	50%	75%	100%

### Over-range / Under-range Indication

Signals above or below the units ranges will be indicated by "HHHH" for above and "LLLL" for below.

### MEASURE (Input)

In this mode, the unit will measure voltage or current.

1. Select Voltage or Current on the Function switch.
2. Turn the meter ON
3. Press the MODE button to select MEASURE
4. Press the UNIT button to select mA or % if current is selected.
5. Connect the Calibration Cable to the meter.
6. Connect the Calibration Cable to the device or circuit under test.
7. Read the measurement on the LCD display.

### SOURCE (Output)

In this mode, the unit will source (output) voltage or current.

1. Select Voltage or Current on the Function switch.
2. Turn the meter ON
3. Press the MODE button to select SOURCE
4. Press the UNIT button to select V or mV if voltage is selected or to select mA or % if current is selected.
5. Connect the Calibration Cable to the meter.
6. Connect the Calibration Cable to the device or circuit under test.
7. Use the  buttons to select the desired output value. Use the LCD display to verify the output level. Alternatively, use the stored calibration values in memory as described in the MEM button section.
8. For the -25% to 125% output range the output is 0 to 24mA.

% Display	-25%	0%	25%	50%	75%	100%	125%
mA output	0mA	4mA	8mA	12mA	16mA	20mA	24mA

**NOTE:** The “SOURCE” icon will blink when the output value has not reached a stable level. The common cause for the “SOURCE” icon to remain blinking is that the load impedance is too high in the current mode or too low in the voltage mode.

# Specifications

---

## General Specifications

## Range Specifications


Copyright 2008 Extech Instruments Corporation (a FLIR company)



more info for Extech 412355A

**Phone: 01235 838 555**

**Email: [cs@airconcern.co.uk](mailto:cs@airconcern.co.uk)**

**Web. [www.airconcern.co.uk](http://www.airconcern.co.uk)**